

CERTAIN 2021-2022 MODEL YEAR CORSAIR, 2020-2022 MODEL YEAR ESCAPE AND 2022 MODEL YEAR MAVERICK VEHICLES EQUIPPED WITH A 2.5L HEV/PHEV ENGINE — UNDER HOOD FIRE

SERVICE PROCEDURE

NOTE: Set the Air Conditioning (AC) to max when bringing the vehicle into the garage to ensure the Active Grille Shutters (AGS) blinds will be open.

Escape and Corsair Vehicles Only

1. Remove the Front Bumper Cover. Please follow the Workshop Manual (WSM) procedures in Section 501-19.

All Vehicles

2. Remove the four required shutter blinds. See Figures 1, 2, 3 and 4.

- First, bend the shutter blind at center and pull toward the front of the vehicle, then remove the OUTBOARD side tab from hole in housing.
- Second, pull to dislodge the INBOARD side tabs via pulling toward outboard the side of vehicle and remove the shutter blind.
- Third, verify all remaining shutter blinds move and do not bind.

NOTE: Maverick shutter blinds can be removed through the bumper cover opening. 

NOTE: AGS assembly removed from the vehicle for clarity.

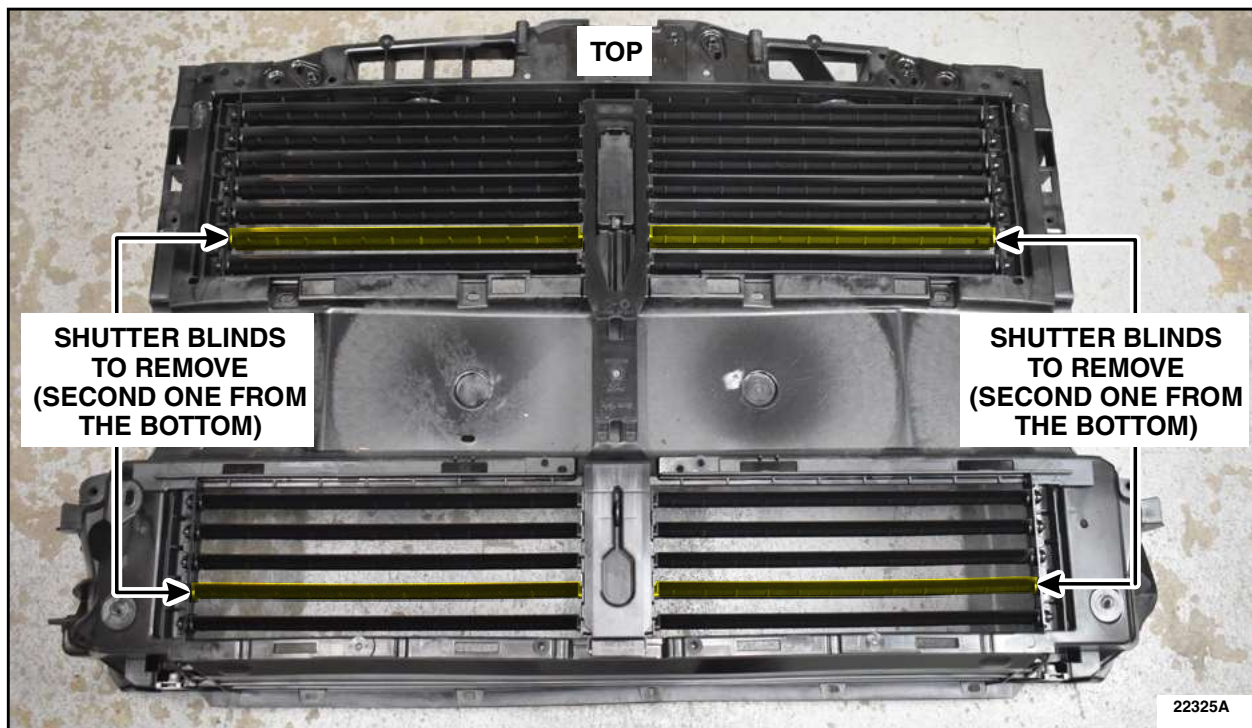


FIGURE 1



NOTE: AGS assembly removed from the vehicle for clarity.



FIGURE 2

NOTE: AGS assembly removed from the vehicle for clarity.



FIGURE 3



Completed AGS Assembly Modification

NOTE: AGS assembly removed from the vehicle for clarity.



FIGURE 4

Escape and Corsair Vehicles Only

3. Reinstall the Front Bumper Cover. Please follow the WSM procedures in Section 501-19.

- Do not reinstall the engine front undershield at this time.

Maverick Vehicles Only

4. Remove the Engine Front Undershield. Please follow the WSM procedures in Section 501-02.

All Vehicles

IMPORTANT: The Ford logo, the part numbers and the side of the engine front undershield that is rough to the touch must be facing up.

5. Place the engine front undershield engine side facing up on a work bench.

NOTE: The engine front undershield features and indentations will be used to locate the areas to be cut out.

